
26

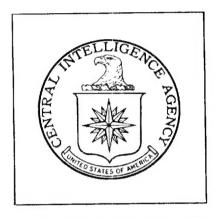

DIRECTORATE OF INTELLIGENCE

Imagery Analysis Report

Failure of San-men Gorge Reservoir Project, China

Declass Review by NIMA/DOD

Top Secret 25X1

Approved For Release 20100786 CREAT DP79T00919A000100260001-3

25X1

IMAGERY ANALYSIS SERVICE

December 1967

FAILURE OF SAN-MEN GORGE RESERVOIR PROJECT, CHINA

SUMMARY


An analysis of photography reveals that
the Chinese were forced to drain the San-men Gorge Reservoir
because of sedimentation problems. The problems encountered
were excessive sedimentation deposits forming within the reservoir and
scouring of the river bed downstream. Failure of this project has deprived
the Chinese of a regulator for flood control, a reservoir capacity for
irrigation and a dependable water supply for the associated hydroelectric
power plant. The plant was in the late stages of construction
but is probably still not in operation. Moreover, the Chinese have been
unable to provide a dependable supply of water downstream for navigation
channels

25X1

-]. **-**



IMAGERY ANALYSIS SERVICE

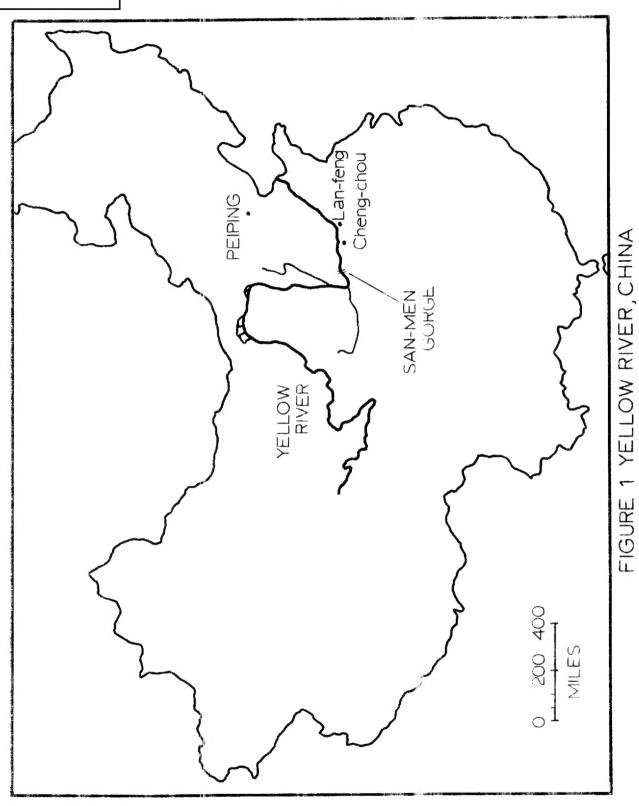

2	5	X	1	

Approved For Release 201207/36 CBATRDP79T00919A000100260001-3

25X1

25X1

IMAGERY ANALYSIS SERVICE

INTRODUCTION

The San-men Gorge Reservoir is located on the middle course of the

25X1

Yellow River at San-men-hsia (34-49-40N 111-20-40E). Construction of this multi-purpose project began in and the dam was closed by

This dam was to be a key project of a Chinese plan for permanently controlling the unruly Yellow River. The Chinese plan, first made public in 1955, included a series of multi-purpose and silt retention dams on the middle course of the main river and many smaller silt retention dams on the tributaries. It was thought that with these silt retention dams and the help of additional soil conservation practices in the drainage area, the usefulness of the multi-purpose reservoir at San-men could be

greatly extended.

25X1

The purpose of this report (based on good to fair quality photography from is to determine the effectiveness of this reservoir as a multi-purpose water conservation project. Annotated photo enlargements are presented along with the discussion of the drainage area, reservoir, hydroelectric plant, navigation, and the effect of retrogression on the diversion of water into the Cheng-chou Irrigation Canal (34-55N 113-36E) and the Lan-feng Irrigation Canal (34-53N 114-44E).

25X1

25X1

25X1

25X1

25X1

25X1

IMAGERY ANALYSIS SERVICE

RESERVOIR

The San-men Gorge Reservoir is situated in a leep canyon on the middle reaches of the Yellow River (Figure 2a). When filled, the reservoir extends 35 nautical miles (nm) upstream from the dam at San-men Gorge to the confluence of the Yellow and Wei Rivers. The reservoir dam is reported to be 350 feet high and is approximately 3,000 feet long. Its capacity is reported to be over 28 million acre feet.

Photography	revealed that the reservoir
was partially filled. The tone of the wa	ater entering the reservoir indicated
that it was carrying a large amount of s:	ilt (Figure 2a), and the volume of
water in the river downstream from the de	am appeare i to have been reduced.
	f the sluite gates were open, the
reservoir was empty, and large deposits	of silt were visible in the reservoir
(Figures 2b and 3). Later photography	
revealed that all of the sluid	ce gates continued to be left open.
and the reservoir was still empty.	

HYDROELECTRIC POWER PLANT

The external features of the hydroelectric power plant associated with
the dam at San-men appeared to be in the late stages of construction on
photography (Figure 4). At this time all of the cofferdams
and the construction equipment that had been located on the river floor were
removed. The switching facility, substation, and ransmission lines were
mearing completion and the last of eight turbogene ator sections was being
roofed; however, it was not possible to determine the number of turbines
or generators that had been installed. Covered transformer cells (two per
Eurbogenerator) were being constructed between the generator hall and dam;
six of the cells were under construction. More resent photo coverage of
indicated that the power house was completely
roofed, and that only three of the transformer cells had been covered. The
switching facility at the western end of the generator hall appeared to be
completed with eight sets of switch gear installed. A cantilever crane was
still located on the roof of the power house, and a traveling support tower
with aerial cable-way was still present. On photography three
turbine housing outlets were discharging water; on photography
Cour outlets were discharging. The spillway has been in operation on all
photographic coverage. Since no head of water has formed and
the discharge from turbine housing outlets observe: in
were from turbogenerator sections where trans ormer cells had not been
completed, it is probable that the power plant was not in operation.

Approved For Release 2002/07/30 - C A-RDP79T00919A000100260001-3

25X1

25X1 25X1

Approved For Release 2002/07/36 CONTROP79T00919A000100260001-3

IMAGERY ANALYSIS SERVICE

DRAINAGE AREA

The drainage area for the reservoir covers over 100,000 square miles consisting of most of the Loess Plateau located in the provinces of Shensi, Kansu, Shansi, and Honan. The principle rivers within this region are the Yellow River and its tributaries.

The Yellow River flows out of the Ordes Desert as a wide, slow river. As the river turns southward from the Great Bend, it enters the Loess Plateau, increases its gradient, and becomes a fast-flowing river in a deep, narrow valley. The main left bank tributary, the Fen, rises in the mountains of eastern Shansi Province and flows southward to its confluence with the Yellow River. The Wei, the main right bank tributary flows from west to east along the foot of the steep northern face of the Tsinling Mountains and carries a heavy load of sediment.

The Loess Plateau is an old dissected peneplain which has been covered by a layer of wind deposited dust varying from a few feet to over 250 feet thick. This light unconsolidated loess is commonly overtilled, and without its natural vegetation cover and under the influence of heavy summer downpours, is extremely susceptible to erosion. Photography reveals (Figure 5) that natural vegetation covers less than five percent of the plateau, and that gully and sheet erosion occur over a large portion of the drainage area. With 65 percent of the total annual rainfall occurring in July, August, and September (Table 1), usually as heavy downpours, tremendous quantities of silt are being washed into the Yellow River.

The immediate task to reduce erosion in a watershed usually is to recreate the natural vegetation by aforestation and grass planting. Recent photography indicates that the Chinese have accomplished very little toward this first step of erosion control nor have they begun construction of silt control dams on the Yellow River and its important tributaries.

EFFECT OF RETROGRESSION ON THE DIVERSION OF WATER INTO THE CHENG-CHOU AND LAN-TENG TRREGATION CANALS

The deposition of sediment in a reservoir and the subsequent release of clear water will generally cause a scour or degradation of river bed below the dam. The removal of bed deposits by clear water may lower the river below existing canal intake structures.

IMAGERY ANALYSIS SERVICE

25X1

25X1

indicated the Photography Chinese are having difficulty in obtaining a sufficient supply of water for the Cheng-chou and Lan-feng Irrigation Projects (Figures 6 and 8) located 130 and 210 nautical miles downstream from the dam. During this five year period the canal intake gates were photographed in both the wet and dry seasons, times when the river would normally be at its highest and lowest Levels. Dates when the water was above or below the intake gates are given in Table 2. This table includes all available coverage from the date the Since there is ins fficient photographic dam was closed until coverage of the canal intake gates before the dam was closed, the extent of retrogression cannot be determined. It is evident, however, that only a small amount of water for irrigation is available during the wet season and that even less water is available during the winter wheat growing season of March, April, and May when evaporation generally exceeds rainfall in these irrigation projects. In addition, during the wet season of 195, flood waters destroyed the major portion of the Cheng-chou Diversionary Dam located at 34-55N 113-36E (Figures 6 and 7). This further complicates the task of obtaining sufficient water for the Cheng-chou Irrigation project.

DOWNSTREAM NAVIGATION

The San-men Reservoir project was part of an overall plan for improving the inland waterway transportation system in China. The San-men Reservoir impoundment was to be utilized, along with additional water from the Yangtze and Han Rivers, to increase the capacity of the downstream navigation channels. The Chinese had planned to make the Yellow River na igable for barge traffic as far inland as Cheng-chou. The failure of the reservoir project would appear to be a serious setback to their ambitious program for improvement of the inland waterway net.

Approved For Release 200 2007/30E CRE-R P79T00919A000100260001-3

IMAGERY ANALYSIS SERVICE

TABLE 1. DISTRIBUTION OF ANNUAL RAINFALL

Reservoir	Dec-Feb	Mar-May	Jun-Aug	Sept-Nov
drainage				
area	4 Percent	15 Percent	56 Percent	25 Percent

TABLE 2. WATER LEVEL ABOVE OR BELOW CHENG-CHOU AND LAN-FENG INTAKE CATES

Cheng-chou	Lan-feng
below	below
above	above
below	below
below below	below below
below	below below
above	above
below	below
below below	below below
below	·below
above	above

Approved For Release 2092/97/38 EC A-RDP79T00919A000100260001-3

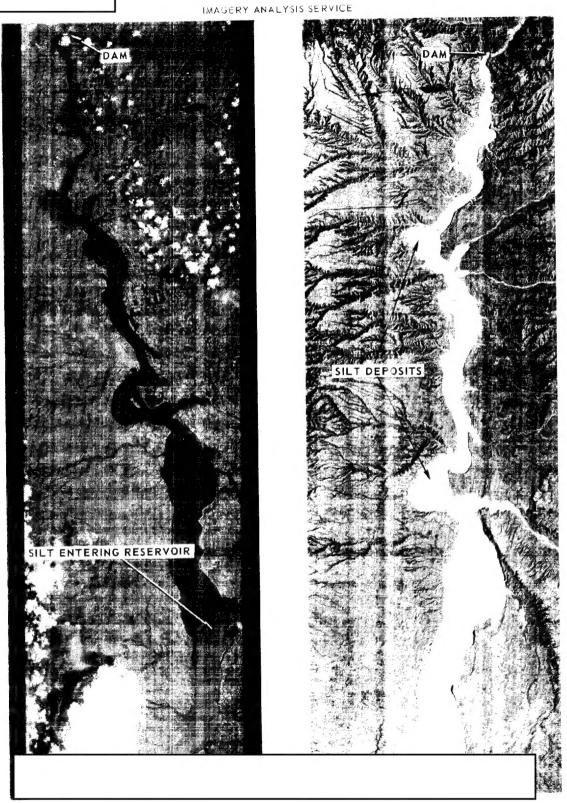


FIGURE 2. SAN-MEN GORGE RESERVOIR

25X1

Approved For Release 200207/SECONTRDP79T00919A000100260001-3

IMAGERY ANALYSIS SERVICE

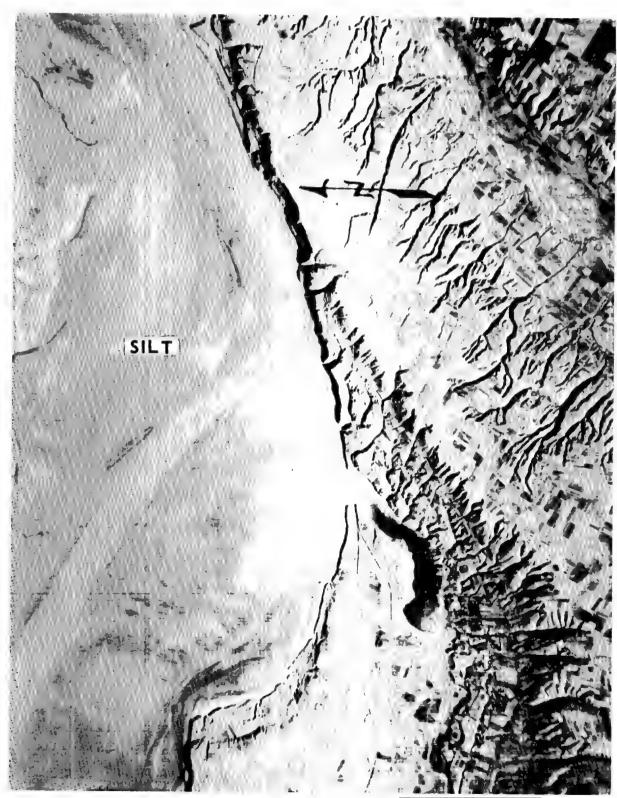


FIGURE 3. SAN-MEN RESERVOIR SILT DEPOSITS,

25X1

Approved For Release 2002/97/68 ECIA-RDP79T00919A000100260001-3

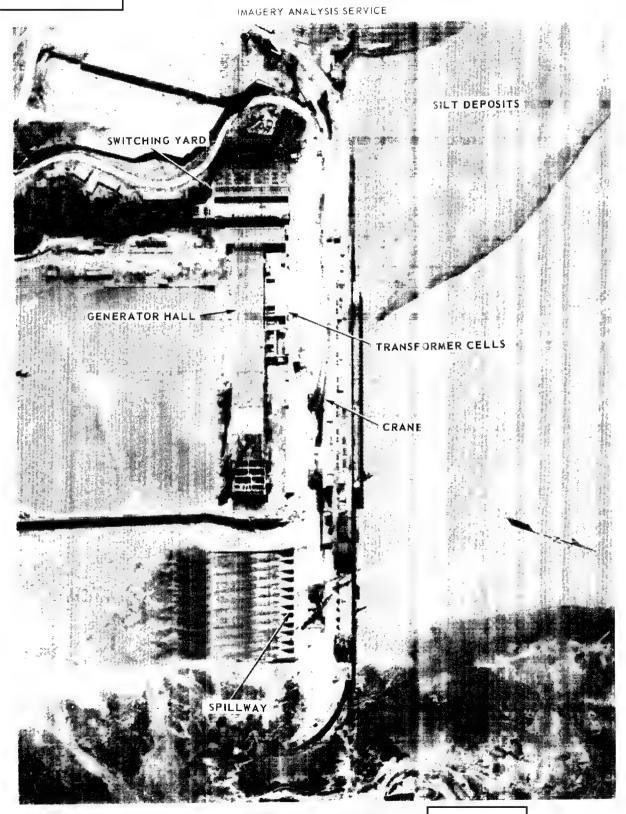


FIGURE 4. SAN-MEN HYDROELECTRIC DAM.

25X1

Approved For Release 2002/0556857A-RDP79T00919A000100260001-3

IMAGERY ANALYSIS SERVICE



FIGURE 5. ERODED LOESS,

Approved For Release 2003/07510(:R14-RDP79T00919A000100260001-3

25X1

IMAGERY ANALYSIS SERVICE



FIGURE 6. CHENG-CHOU CANAL INTAKE GATE.

25X1 25X1

Approved For Release 2002007/36ECRE-RDP79T00919A000100260001-3

IMAGERY ANALYSIS



FIGURE 7. CHENG-CHOU CANAL INTAKE GATE.

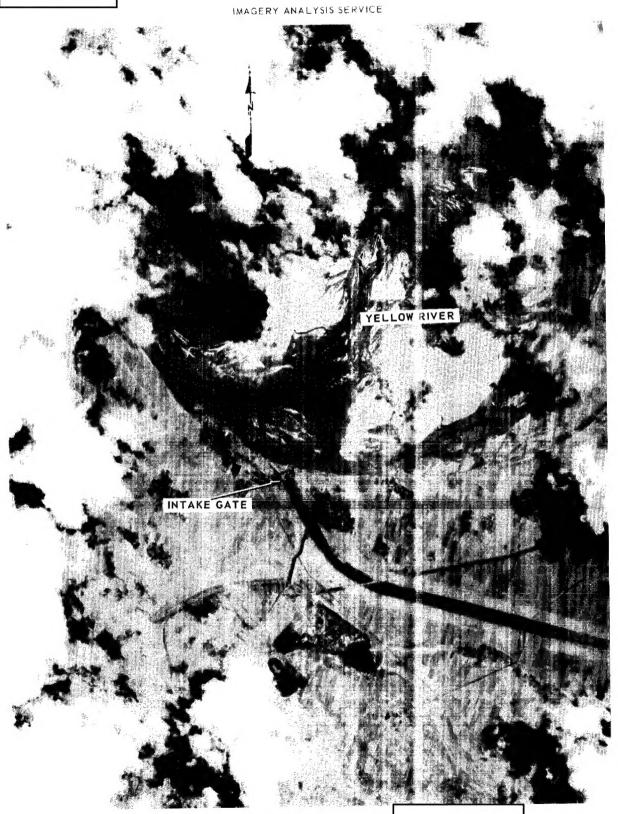


FIGURE 8. LAN-FENG CANAL INTAKE GATE,

Approved For Release 2002/07/2007 Eth-RDP79T00919A000100260001-3

25X1

Approved For Release 2002(17/120F:TGIA-RDP79T00919A000100260001-3

IMAGERY ANALYSIS SERVICE

Mers and Charts

- ACIC. USAM Operational Navigation Chart, Sheet (C-G-9, scale 1: , C., Ot.) and electicaled., March 1963 (CONFIDENT at.)
- US Air Target Chart, Series 200, Sheet UB VAL, scale 1:200,000 ist ed., August 1960 (SECRET)
- ACIC. US Air Target Chart, Series 200, Sheet 330 -991, scale 1:200,000 and ed., November 1963 (SECRET)

Locuments

- 1. Tragear, T.R., A Leography of China, Aldine ablishing company, Chicago, 1989 (UNCLASSIFIED)
- 2. JPRS. Water Resources of China, November 19 (UNCLASSIFIED)
- 3. JPRS. Climate of China, June 1967 (UNCLASS FIED)
- JPRS. The Physical Geography of China, Sept aber 1965 (UNCLASSIFIED) 11.
- 5. Stanley, J.W., "Retrogression on the Lower C Lorado River after 1935," American Society of Civil Engineers, April 1 -7 (UNCLASSIFIED)
- 6. Conflitzen, W.E., 'Economic Effects of Reserv in Sedimentation,' American Society of Civil Engineers, April 1997 (UNC ASSIFIED)

Requirement

C-RR7-54,520

EAS Project

30406 3

Approved For Release 2002/07/30 : CIA-RDP79T00919A000100260001-3

Top Secret